

OFFICE OF THE MARION COUNTY SURVEYOR

SECTION RECORD CORNER

SECTION 22 TOWNSHIP 17 RANGE 5

DATE: ~~-----5-3-02~~ 12-03-04

PARTY CHIEF: Wilcoxon

CREW: _____

TYPE OF MARKER: -Broken Harrison



METHOD OF ESTABLISHMENT: County: 7-9-97

IN. S.P.C. E ZONE NAD '83

NAME: 17052204

N: 517082.4130(m)

E: 75162.3700(m)

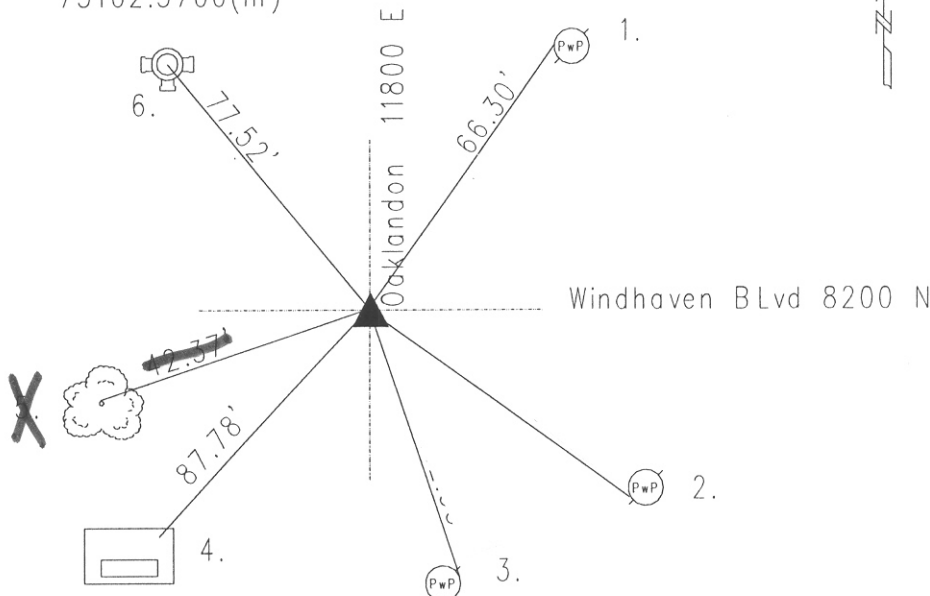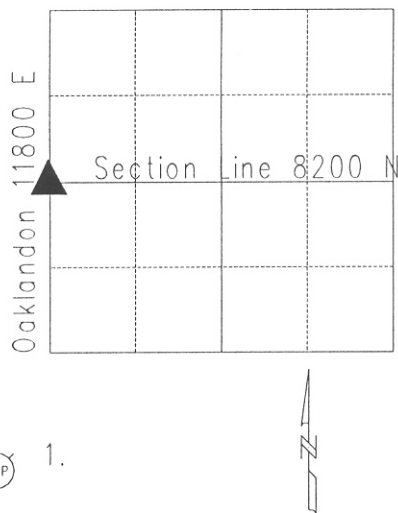

Original post set 1821 by Laughlin with witness: 10" beech N 69 W 3 links; 36" white oak S 24 E 40 links. Legal 6-1869 by Voorhis per Lawrence Township Legal Survey Book pg. 11 called corner 'B', but does not call type of marker. Two witnesses were described 15" elm N 41 E 90 links, 10" cherry N 37 W 116 links. Legal Survey 10-1874 by Voorhis per :Lawrence Township... pg. 35 called corner 'B' marker as being found...rock set by different surveyors. 10-8-53 Monroe called stone at corner. 5-27-70 McLand called stone fd 11" dn. Cripe Job#7426 called corner stone fd per MCSO. Distance and bearing information to corners to the E,N & S given.4-24-75 Fortner called PK nail. 8-15-79 Bruer called same. Excavated 7-1-82 by Cleveland. 2'x2' hole dug 3' deep. PK nail at surface fd over high pt of stone. 90 lbs. Removed ..set Harrison. Re-tied 7-9-97 and railroad spike fd over broken Harrison. Re-tied 5-3-02 by Wilcoxon.

REF.	DISTANCE	DESCRIPTION
1.	66.30'	PK nail W PwP#331-221 RB 15"up
2.	95.18'	PK nail w/shiner SW PwP no# 18"up
3.	112.46'	PK nail w/shiner E PwP#66-251 FA 12"up
4.	87.78'	Cut 'x' NE concrete telephone box base
5.	42.37'	Boat spike N 30" silver maple 6"up
6.	77.52'	Top nut of fire hydrant